


# Mesquite Material Testing, L.L.C

Phone: 702-346-2050 Fax: 702-345-3133

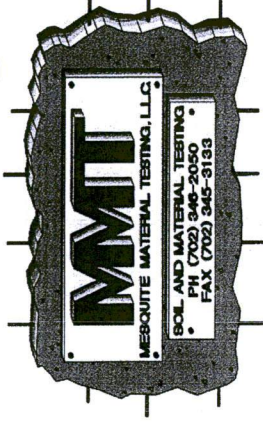

## FIELD DENSITY TEST REPORT

PROJECT Hitters Subdivision Phase I

TYPE MATERIAL Native


TECHNICIAN N. Thomas

TYPE OF WORK Bottom of Over Excavation - Precompaction

JOB NO. 138-61

Date	Test No.	Station / Location	Offset from C/L	Elevation Reference	Elevation	Depth of Test	Maximum Dry Density	Optimum Moisture	Density Count	Moisture Count	Wet Density	Dry Density	Percent Moisture	Percent Compaction	Required	Pass/Fail
05/23/08	1	53479.601 North		FGS	-10'	10"	119.0	10	952	106	120.1	110.6	8.6	92.9%	90.0%	Pass
05/23/08	2	41233.150 East		FGS	-10'	10"	119.0	10	821	132	125.5	113.2	10.8	95.1%	90.0%	Pass
05/23/08	3	53575.653 North		FGS	-10'	10"	119.0	10	832	149	124.9	110.8	12.7	93.1%	90.0%	Pass
		41375.655 East														
		53534.816 North														
		41537.808 East														

DAILY COUNTS: Gauge No.  Density  Moisture

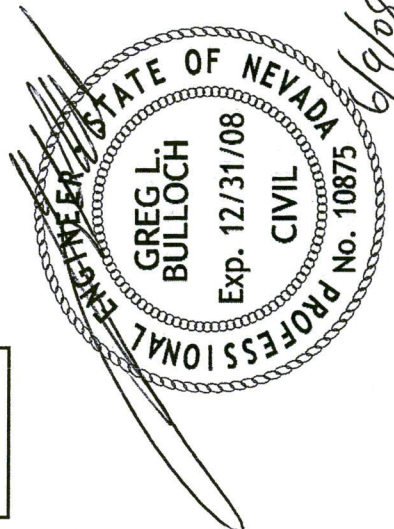

Reviewed by: Greg L. Bulloch

5-38-9



